

Thursday, 3/13/2008 1:01:57 PM
Kim Johnston

Process Sheet

13

Customer	: CU-DAR001 Dart Helicopters Services	Drawing Name	: X-TUBE AS 350/355 HI AFT UNDER REVIEW
Number	: 38001		
imate Number	: 13225		
D. Number	:	Part Number	: D350748241TRN
is Issue	: 3/13/2008 S.O. No. :	Drawing Number	: D350-748-241 UR
Prsht Rev.	: NC	Project Number	: N/A
First Issue	: / / Type : LANDING GEAR	Drawing Revision	: 0 D
Previous Run	: 38000	Material	:
Written By	:	Due Date	: 3/28/2008 Qty: 1 Um: Each
Checked & Approved By	:		
Comment	: Est Rev:A New Issue 08-03-06 DD verified by:ec		

08.03.18

Additional Product

Job Number:



Seq. #:	Machine Or Operation:	Description :
---------	-----------------------	---------------

1.0	D6018125	Crosstube Material
-----	----------	--------------------



Comment: Qty.: 1.0000 Each(s)/Unit Total : 1.0000 Each(s)
Crosstube Material
D6018-125
2.299" OD X 2.000" ID
Batch: B32913

a.m 08.04.11 (1)

2.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Fill tube with sand & install plugs on both ends as per Folio FA647

2-Turn first side as per Folio FA647

3-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D350-748-241.

a.m 08.04.15 (1)

3.0	QC1	INSPECT ALL DIM TO DIM SHEET
-----	-----	------------------------------



Comment: INSPECT ALL DIM TO DIM SHEET

a.m 08.04.15 (1)

4.0	MORI SEIKI	MORI SEIKI CNC LATHE LARGE
-----	------------	----------------------------



Comment: MORI SEIKI CNC LATHE LARGE

1-Turn second side as per Folio FA647

2-Deburr & Inspect for surface damage. Repair damage within limits as per Dwg D350-748-241.

3-Scribe part # as per Dwg D350-748-241

a.m 08.04.15 (1)

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/13/2008 1:01:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT UNDER REVIEW

Job Number: 38001

Part Number: D350748241TRN

Job Number:



Seq. #: Machine Or Operation: Description :

5.0 QC1 INSPECT ALL DIM TO DIM SHEET



Comment: INSPECT ALL DIM TO DIM SHEET

AWM 08.04.15 (1)

6.0 QC8 SECOND CHECK



Comment: SECOND CHECK

AWM 08/04/15 (1)

7.0 LANDING GEAR 1 LANDING GEAR RESOURCE 1



Comment: LANDING GEAR RESOURCE 1

Remove all Machining Marks

AWM 8-4-16

8.0 QC5 INSPECT WORK TO CURRENT STEP



Comment: INSPECT WORK TO CURRENT STEP

08/04/17 (1)

9.0 OUTSIDE SERV.10 OUTSIDE SERVICES -LG



Comment: Sub-Contracting OUTSIDE SERVICES

Issue P/O: *6168*

Heat Treat to min 180 KSI As per Dwg D350-748-241

Sand Blast tube after Heat Treat

Possible Supplier: Vac Aero

Ensure Certificate of Conformity is attached

08/04/17 (1)

10.0 PACKAGING 1 PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Receive & Inspect For Transit Damage

Ensure certificate of conformaty is attached

08/02/09 (1)

11.0 QC6 DIMENSIONAL CHECK



Comment: DIMENSIONAL CHECK

08/06/02 (1)

12.0 HAND FINISHING1 HAND FINISHING RESOURCE #1



Comment: HAND FINISHING RESOURCE #1

Oil inside of tube with LPS-3.

N/A 08-07-09

A/R LPS-3 Batch: _____

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

Date: Thursday, 3/13/2008 1:01:57 PM
User: Kim Johnston

Process Sheet

Customer: CU-DAR001 Dart Helicopters Services

Drawing Name: X-TUBE AS 350/355 HI AFT UNDER REVIEW

Job Number: 38001

Part Number: D350748241TRN

Job Number:



Seq. #:

Machine Or Operation:

Description :

13.0

PACKAGING 1

PACKAGING RESOURCE #1



Comment: PACKAGING RESOURCE #1

Identify and stock in kanban rack

Location:

X-tube Cell

DP 8-7-9

14.0

QC21

FINAL INSPECTION/W/O RELEASE



08/07/22

Comment: FINAL INSPECTION/W/O RELEASE

Job Completion



mf 08-07-22

Dart Aerospace Ltd

W/O:		WORK ORDER CHANGES					
DATE	STEP	PROCEDURE CHANGE	By	Date	Qty	Approval Chief Eng / Prod Mgr	Approval QC Inspector

Part No: _____ PAR #: _____ Fault Category: _____ NCR: Yes No DQA: _____ Date: _____

QA: N/C Closed: _____ Date: _____

NCR:		WORK ORDER NON-CONFORMANCE (NCR)						
DATE	STEP	Description of NC Section A	Corrective Action Section B			Verification Section C	Approval Chief Eng	Approval QC Inspector
			Initial Chief Eng	Action Description Chief Eng	Sign & Date			

NOTE: Date & initial all entries

DART AEROSPACE LTD	Work Order:	38001
Description: Crosstube Assembly (AS350/355 High Aft)	Part Number:	D350-748-241
Inspection Dwg: D350-748-241 Rev: D		Page 1 of 1

FIRST ARTICLE INSPECTION CHECKLIST

☒ First Article ☐ Prototype

Inspection Sheet Drawing Dimension		Tolerance	Actual Dimension	Accept	Reject	Method of Inspection	Comments
SIDE A	2.240	+0.005/-0.000	2.243	✓			
	2.180	+0.005/-0.000	2.183	✓			
	2.180	+0.005/-0.000	2.185	✓			
	2.208	+0.005/-0.000	2.212	✓			
	2.234	+0.005/-0.000	2.234	✓			
	2.253	+0.005/-0.000	2.253	✓			
	2.272	+0.005/-0.000	2.275	✓			
	2.299	+0.005/-0.000	2.299	✓			
	0.063	+/-0.010	0.063	✓			
	4.26	+/-0.030	4.275	✓			
	R0.063	+/-0.010	R0.063	✓			
	R0.50	+/-0.030	R0.50	✓			
SIDE B	2.240	+0.005/-0.000	2.243	✓			
	2.180	+0.005/-0.000	2.184	✓			
	2.180	+0.005/-0.000	2.185	✓			
	2.208	+0.005/-0.000	2.213	✓			
	2.234	+0.005/-0.000	2.236	✓			
	2.253	+0.005/-0.000	2.253	✓			
	2.272	+0.005/-0.000	2.274	✓			
	2.299	+0.005/-0.000	2.299	✓			
	0.063	+/-0.010	0.063	✓			
	4.26	+/-0.030	4.277	✓			
	R0.063	+/-0.010	R0.063	✓			
	R0.50	+/-0.030	R0.50	✓			
	122.70	+/-0.060	122.735	✓			

Measured by:	a.m	Audited by:	/AWM	Prototype Approval:	N/A
Date:	08.04.15	Date:	08/04/15	Date:	N/A

Rev	Date	Change	Revised by	Approved
A	07.01.17	New Issue (P/O D350-748-201)	KJ/JLM	

DART

DESIGN <i>qp</i>	DRAWN BY <i>qp</i>	DART AEROSPACE LTD HAWKESBURY, ONTARIO, CANADA	
CHECKED <i>///</i>	APPROVED <i>///</i>	DRAWING NO. D350-748-241	REV. D SHEET 1 OF 3
DATE 06.10.31		TITLE CROSSTUBE (AS 350/355 HI AFT) SCALE NTS	
A	06.03.31	NEW ISSUE	
B	06.06.30	ADD D6018-125 & PRIME AND PAINT	
C	06.08.14	ADD CAD PLATING	
D	06.10.31	MAG. PARTICLE AND CAD PLATE AS MFD.	

RELEASED06.10.31 *///*

QTY	P/N	DESCRIPTION
X	D350-748-241	CROSSTUBE ASSEMBLY (AS 350/355 HI AFT)
1	D6018-125	CROSSTUBE (OR D6015-125)
2	D3502-1	SUPPORT
2	D2856-400-710	ABRASION STRIP
1	AELS-1032-225	INSERT
1	AN960JD10	WASHER
2	MS21920-20	CLAMP (PER DART SPEC. M-MS21920-20)
1	MS27039-1-10	SCREW




D350-748-141 CROSSTUBE:

- 1) MATERIAL: MANUFACTURED FROM D6018-125 OR D6015-125
FINISHED LENGTH = 122.70±0.06
- 2) MACHINE PER MACHINING DETAIL ON PAGE 3. BLEND OUT ALL EDGES FROM MACHINING LONGITUDINALLY, TRANSITIONS SHOULD BE SMOOTH. NOTE: ALL HOLES ARE DRILLED AFTER BENDING.
- 3) SCRIBE DART PART NUMBER AND BATCH NUMBER IN THIS AREA WITH VIBRATING STYLUS
- 4) BEND PROGRESSIVELY WITH A MINIMUM OF 7 PASSES. MAXIMUM TUBE FLATTENING DUE TO BENDING IS 6% BASED ON O.D.
- 5) HEAT TREAT TO MIN. 180 KSI PER MIL-T-6736 OR AMS 2759-1C AFTER TURNING
- 6) FINISH: MAGNETIC PARTICLE INSPECT PER DART QSI 038 4.2
CADMIUM PLATE PER AMS-QQ-P-416B, CLASS 1, TYPE II
PRIME INSIDE AND OUTSIDE PER DART QSI 005 4.2
PAINT OUTSIDE PER DART QSI 005 4.2
- 7) EXTREME CARE MUST BE TAKEN TO PROTECT THE OUTSIDE SURFACE OF THE TUBE. THE OUTSIDE SURFACE MUST BE SMOOTH AND FREE FROM SURFACE DEFECTS SUCH AS SCRATCHES, NICKS, OR DENTS. DEFECTS UP TO 0.005" MAY BE BLENDED OUT LONGITUDINALLY. CIRCUMFERENTIAL GRIND MARKS ARE UNACCEPTABLE. WHEN DRILLING HOLES EXTREME CARE MUST BE TAKEN AND CAREFUL DEBURRING PERFORMED TO ENSURE A CLEAN HOLE WITH NO CRACKING/CHIPPING/GROOVES.
- 8) INSTALL D2856-400-710 ABRASION STRIP WITH A GAP ON BOTTOM SIDE OF CROSSTUBE, CENTERED OPPOSITE D3502-1 SUPPORT, PER QSI 035.
- 9) TORQUE MS21920-20 CLAMPS 60 TO 80 IN-LB
- 10) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED.
- 11) ALL DIMENSIONS ARE IN INCHES
- 12) PART IS SYMMETRIC ABOUT CENTERLINE EXCEPT FOR Ø0.297 HOLE.

UNDER REVIEW07.02/16 *///*CUT FOR REVIEW
07.02.22

Copyright © 2006 by DART AEROSPACE LTD


THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

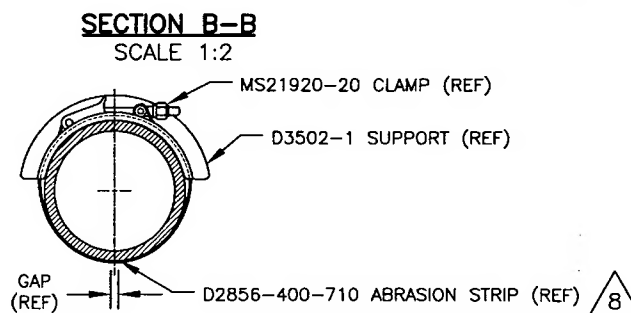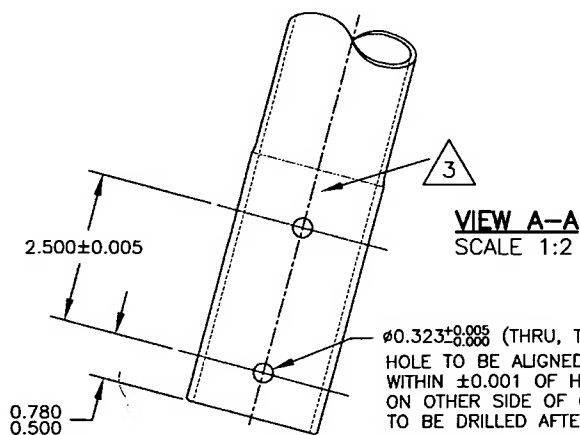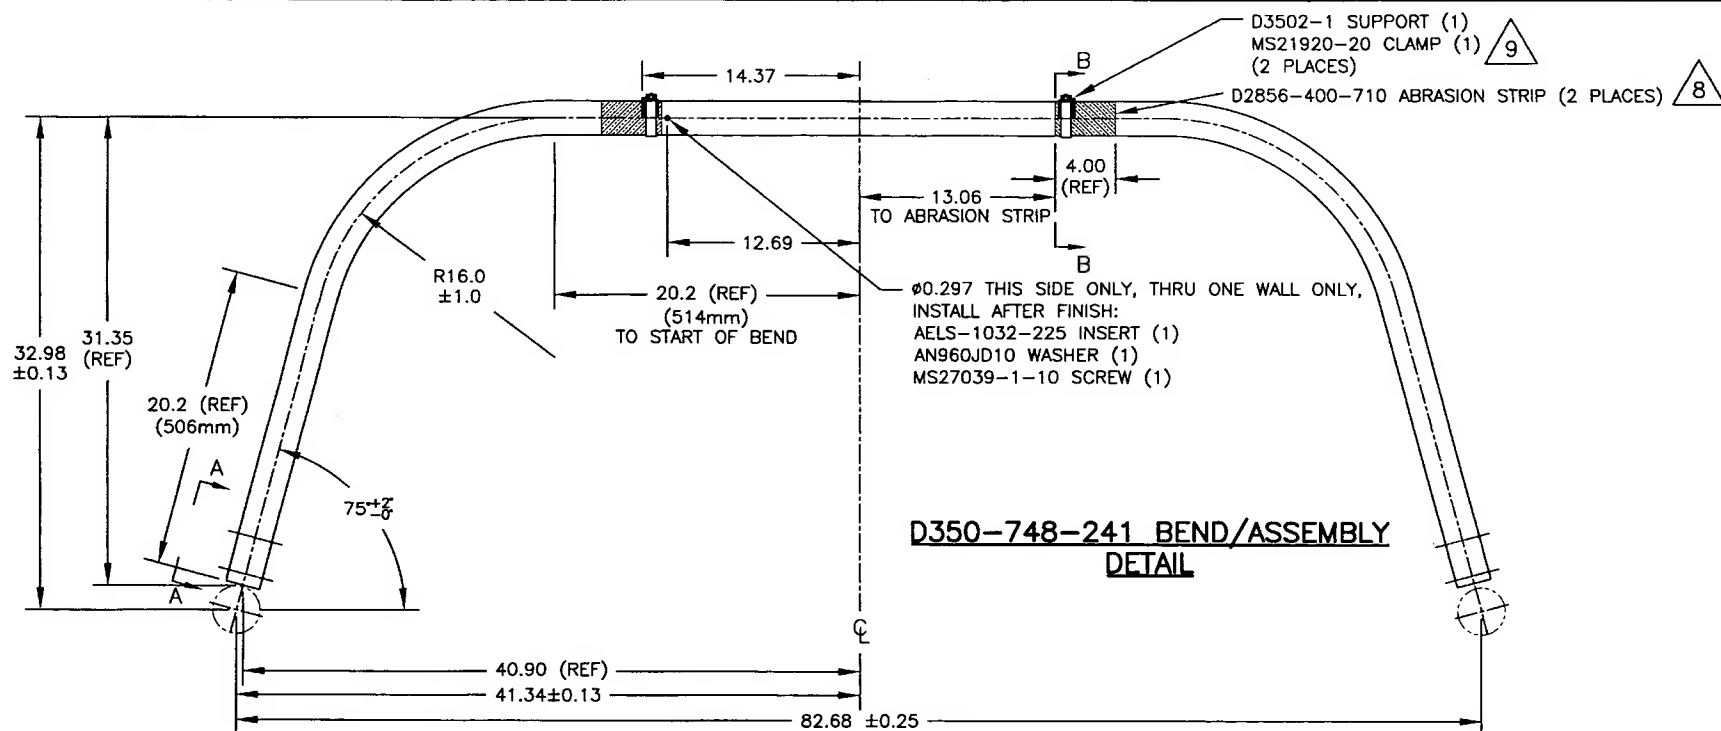

UNDER REVIEW
07.02/16/17
CUFF BEING REDUCED
06.10.31
RELEASED
06.10.31

COPYRIGHT © 2006 BY DART AEROSPACE LTD.		DESIGN	q2	DRAWN BY	q2	DART	DART AEROSPACE LTD. HAMMERSLEY, ONTARIO, CANADA
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.		CHECKED	#	APPROVED	#	DRAWING NO.	REV. D
		DATE	06.10.31			D350-748-241	SHEET 2 OF 3
						TITLE	SCALE
						CROSSTUBE (AS 350/355 HI AFT)	1:8

SHOP COPY
RETURN TO
ENGINEERING
UNCONTROLLED COPY
SUBJECT TO AMENDMENT
WITHOUT NOTICE
NO. 38001
V.001


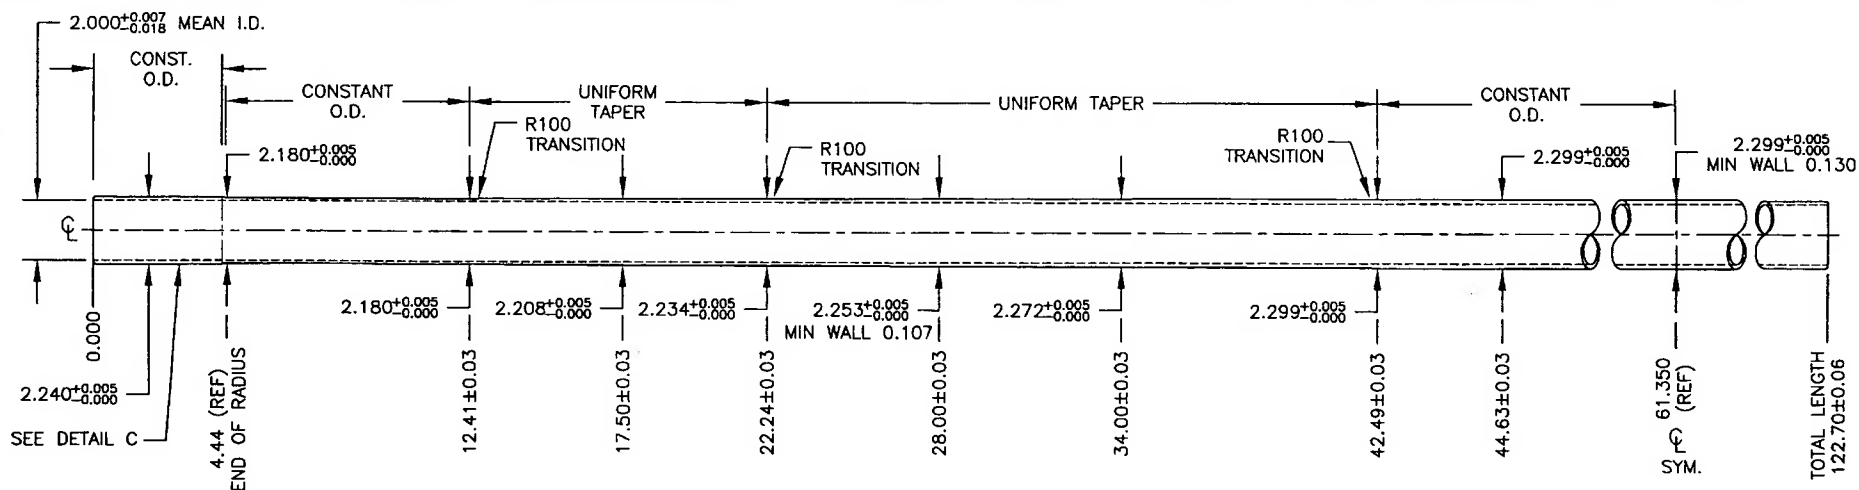


D350-748-241 MACHINING DETAIL

UNDER REVIEW

07.02/16/11
CUFF FROM REVISION
06.10.31

DETAIL C: CUFF SCALE 1:1

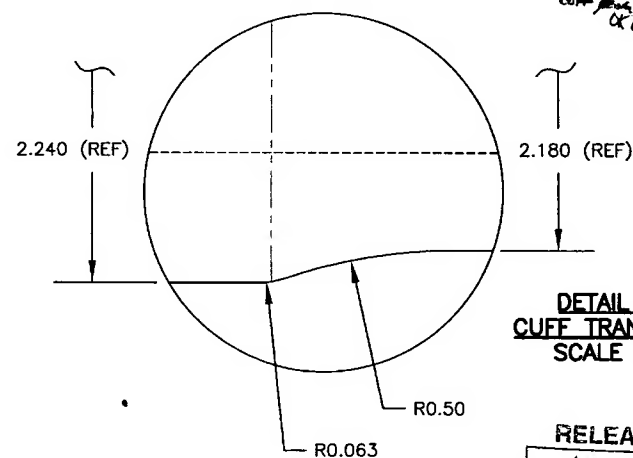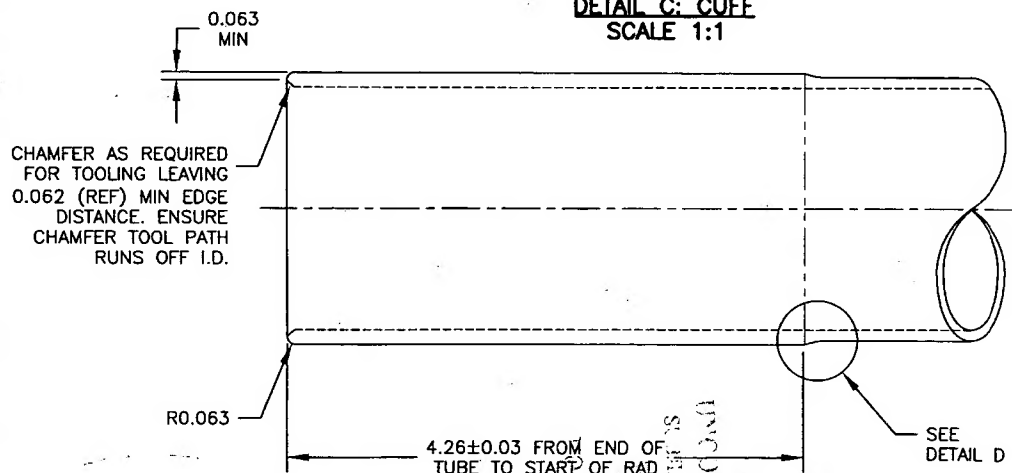

DETAIL D: CUFF TRANSITION SCALE 9:1

RELEASED

06.10.31

COPYRIGHT © 2006 BY DART AEROSPACE LTD.

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE LTD.

DESIGN qp	DRAWN BY qp	DART	DART AEROSPACE LTD. HAMPSHIRE, ENGLAND, CANADA
CHECKED #	APPROVED #	DRAWING NO. D350-748-241	REV. D SHEET 3 OF 3
DATE 06.10.31	TITLE CROSSTUBE (AS 350/355 HI AFT)	SCALE 1:4	

38001

ENGINEERING
RETURN TO
SHOP COPY



VAC AERO
INTERNATIONAL INC.

RELEASE NOTE

GST No.: R105468102

OAK 97912-1

☒ HEAD OFFICE
1371 SPEERS ROAD, OAKVILLE, ONTARIO
CANADA L6L 2X5
TEL: (905) 827-4171 FAX: (905) 827-7489

☐ 2009 WYECROFT ROAD, UNIT B
OAKVILLE, ONTARIO
CANADA L6L 6J4
TEL: (905) 827-7377 FAX: (905) 827-1380

☐ QUEBEC DIVISION
7450 RUE VÉRITÉ STREET, ST. LAURENT, QUÉBEC
CANADA H4S 1C5
TEL: (514) 334-4240 FAX: (514) 334-6269

05/27/2008

MM/DD/YYYY

PAGE: 1

1DAR01
BILL TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON


SHIP TO: DART AEROSPACE LTD.
1270 ABERDEEN ST.
HAWKESBURY, ON

K6A 1K7

K6A 1K7

DATE SHIPPED	SHIP VIA	F.O.B.
05/27/2008		ORIGIN
CUSTOMER P/O No.	JOB No.	TERMS
PO00006168		NET 30 DAYS

PART No.	DESCRIPTION	UOM	QTY ORD	QTY SHPD	TEST RESULTS
D350-748	-141	EA	16	16	
Process Specifications: Procedure: 4353 HEAT TREATED TO 180 KSI MIN. PER AMS 2759-1D 100% HARDNESS CHECKED AS PER ASTM E-18: 40-45 HRC MATERIAL: 4130 SAND BLASTED PARTS P/S# 214602					
8 PIECES P/N D350-748-141 S/N B37992, B37993, B37994, B37995, B37996, B37997, B37998, B37999					
8 PIECES P/N D350-748-241 S/N B38000, B38001, B38002, B38003, B38004, B38005, B38006, B38007					
NOTE: NO SERIAL NUMBERS FOUND ON PARTS					

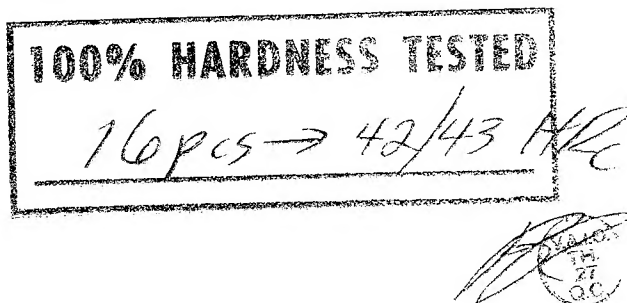

I hereby certify that the material covered by this release note has been inspected and tested and conforms to all specifications relevant thereto in accordance with the conditions of the contract / or purchase order.

ON BEHALF OF VAC AERO INTERNATIONAL INC.

Authorized Q.C. Inspector

J.A.I.O.
TH.
27
Q.C.



VACUUM BRAZING · HEAT TREATING · SPECIAL PROCESSING · FURNACE EQUIPMENT
TURBINE COMPONENT OVERHAUL · PLASMA AND OTHER COATINGS

